



BRAKE LEVER FREE PLAY ADJUSTMENT, CB-750

APPLICATION:

Pre-K1 CB-750 motorcycles only (frame number CB750-1000001 through CB750-1044649).


NOTE: CB-750 K1 motorcycles (frame number CB750-1044650 and subsequent) do not have adjustable brake lever free play.

INSPECTION AND ADJUSTMENT:

Brake lever free play, measured at the tip of the lever, should be maintained at $\frac{1}{4}$ to $\frac{1}{2}$ inch.

If brake lever free play exceeds specified limits, adjust as follows:

1. Loosen lock nut.
2. Turn adjusting bolt to provide $\frac{1}{4}$ to $\frac{1}{2}$ inch free play at tip of lever.
3. Apply Lock-Tite to threads of adjusting bolt, and tighten lock nut to a torque of 13–17 ft. lbs.

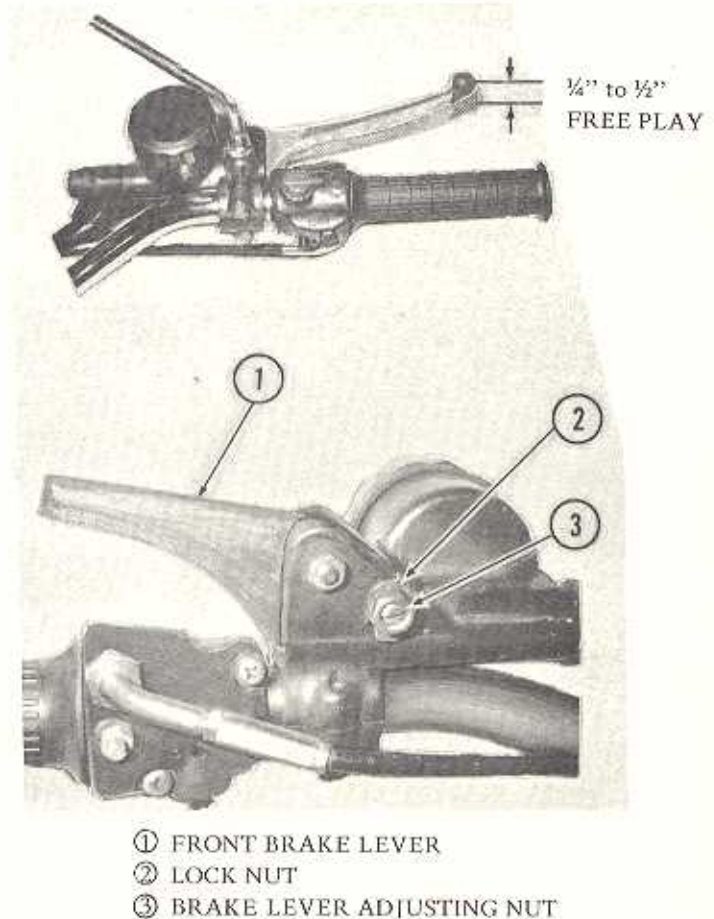

9-795

AMERICAN HONDA MOTOR CO., INC.
MOTORCYCLE SERVICE DEPARTMENT

This revision supersedes Service Bulletin 750 #11, dated 1/12/70, which should be removed and destroyed.

ROUTING:

COPY 1
COPY 2

GENERAL MANAGER
 SERVICE MANAGER

SALES DEPT
 MECHANICS

OFFICE FILE
 SHOP FILE